

POOR GLOSS

Not enough finish on floor Scrub and rinse floor, apply finish

Not enough time between coats Wait 30-40 minutes between coats

Coats are too thin Never fully wring finish mop

Old, damaged or overly porous floor Apply sealer first, then floor finish

Cleaners

Use appropriate or recommended cleaners according to directions

Dirt and Sand

Use entrance mats, dust mop often

Improper rinsing before recoating After stripping, use flood rinses

Burnishing pads are too aggressive Use proper pads for various jobs

Floor temperature below 55°F On cold days, check floor temperature before applying finish

Fans directly on finish while drying Point fans upward, away from floor

STREAKING

Recoating too soon

Give at least 20-30 minutes between coats; stop if there is mop drag

Contamination on the floor/furniture polish, mop treatment, etc.

Remove source of contamination; strip, rinse, and recoat

Dirty mops/unclean equipment

Use only clean mops and buckets for floor finish/use can liner inside bucket

Finish exposed to extreme temperature Do not apply finish that's been frozen

Coats are too thin Apply medium to full coats of finish

DISCOLORATION

Coating over dirt

Always clean floor before recoating

Poor daily cleaning/Burnishing over dirt Clean floor daily/ Always clean floor before burnishing/ Use walk off mats

Applying finish with new cotton mop Soak and clean new mops before use

Quat disinfectant residues

Scrub or mop wash floor once a week with an all-purpose cleaner

Colored floor pads

Use natural, white, or tan pads for burnishing

If you have additional questions, please contact our research department